

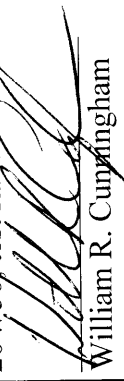
POWERMASTER AIRCRAFT ENGINES

9027 S. Airport Way
Jones/Riverside Airport
Tulsa OK 74132
918-299-0269
FAA CRS # P46R287Y

10-1-2009
TSIO-520P
SN-513123

WO# PAE 3047

Disassembled engine. Overhauled cylinders, replaced exhaust guides, reamed and honed guides, ground seats, installed new exhaust valves, honed barrels, fit P15 ring sets. Note: Piston and cylinder assemblies P15 oversize. Installed new 535661 camshaft and 6 653877 and 6 each 653888 overhauled hydraulic lifter assemblies from Aircraft Specialties. Completed engine assembly in accordance with TCM Overhaul manual X30575A. Engine torqued per TCM Service Bulletin 96-7B. Installed new CH48109 filter, serviced engine with 12QTS Phillips 20W50, test ran and leak checked.


William R. Cunningham
Powermaster Inc.

FAA CRS# P46R287Y

IN OF INSPECTIONS, TESTS, REPAIRS AND ALTERATIONS
ENDORSED WITH NAME, RATING AND CERTIFICATE NUMBER OF
FAIR FACILITY. (SEE BACK PAGES FOR OTHER SPECIFIC ENTRIES.)

Inspection Performance Comp OK #170
100 lbs Aeroshell. All Prop for
100 lbs Aeroshell. All Prop for
100 lbs Aeroshell. All Prop for

at This Aircraft Engine
Inspected In Accordance
with FAR Inspection & Waiver
Be In Airworthy Condition

JF Aviation Inc
2006.02
3000 W. JEFFERSON STREET
MOLLET, ILLINOIS 60435

