
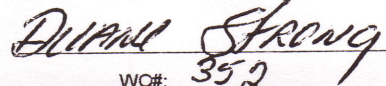

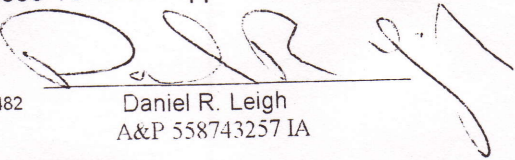


DESCRIPTION OF ALL OPERATIONS  
PERTAINING TO AIRWORTHINESS DIRECTIVES,  
SERVICE BULLETINS, SERVICE LETTERS,  
& MINOR ADJUSTMENTS

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
July 25, 01	306.4	Removed prop due to nick on prop blade. Sent to Sullivan prop for 94 to inspect prop. Egan McConley Inspected manually	
8-25-02	326.4	Completed annual inspection. Egan Egan checked list 500. WO # 352 for details.	
		 <b>Eagle's Nest Aviation</b> Quality Aircraft Services CRS# E4KR847Y	 Duane Strong WO#: 352

DESCRIPTION OF ALL OPERATIONS  
PERTAINING TO AIRWORTHINESS DIRECTIVES,  
SERVICE BULLETINS, SERVICE LETTERS,  
& MINOR ADJUSTMENTS

**N6563D**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
		N 6563D 11/15/03 Tach:671.1 I certify this propeller has been inspected in accordance with an 100 hour inspection and was determined to be in an airworthy condition. AD# 2003-13-17 not applicable due to serial number.	
		 <b>Eagle's Nest Aviation</b> Quality Aircraft Services 1465 S. State Street, Ukiah, CA 95482 707-462-0110	 Daniel R. Leigh A&P 558743257 IA
12-18-08	1326.9	Hobbs 33650 TTS014 1062.7 Prop blades dressed and painted I certify that this prop has been inspected Egan an annual inspection and was found to be in an airworthy condition E.A. 55548509 Duane Strong	

TOM'S AIRCRAFT ENTERPRISES  
 4475 HIGHLAND SPRINGS ROAD  
 LAKEPORT, CA 95453  
 (707) 263-9330

DESCRIPTION OF ALL OPERATIONS  
 PERTAINING TO AIRCRAFT BUSINESS DIRECTIVES,  
 SERVICE LETTERS,  
 ADNOTES

Reg#: N6563D Make: MCCAULEY D3A34C402/90DFA310N: 814868  
 Date: 09-29-2000 Tach: 12.5 Hobbs: 2308.1 SMOH: 12.5

ORR

SIGNATURE

\*\*\*ANNUAL INSPECTION\*\*\*

I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED  
 IN ACCORDANCE WITH AN ANNUAL INSPECTION AND WAS  
 DETERMINED TO BE IN AIRWORTHY CONDITION.

*Tom L. Wasson*

TOM L. WASSON A&P 1378002 IA


**SULLIVAN PROPELLER SPECIALISTS**

20995 Skywest Drive • Hayward, California 94541  
 tel: 510.782.0920 • fax: 510.264.9162  
 FAA Repair Station S5UR963J

McCauley  
 Model No. D3A34C402  
 Serial No. 814808

August 25, 2001

Completely overhaul propeller assembly. Function test for operation and leaks -  
 result ok. All work performed in accordance with McCauley Manufacturers' Service  
 Manual No. 761001. Work Order No. 3326 on file.--END.

Comply with Service Bulletins: 106,119A,154E, 172B,192A.--END.  
 AD Notes: 82-27-02, revision 1 dated 02-23-83 not applicable.--EBD